



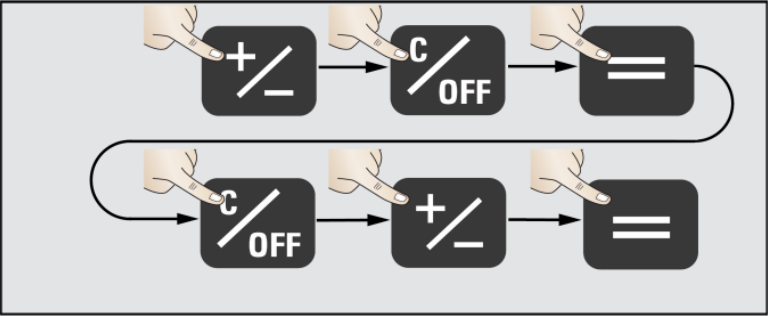
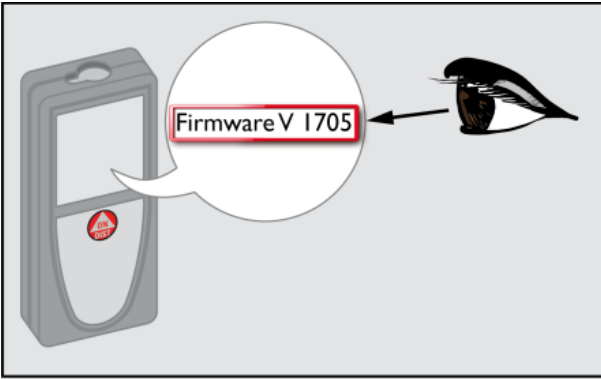
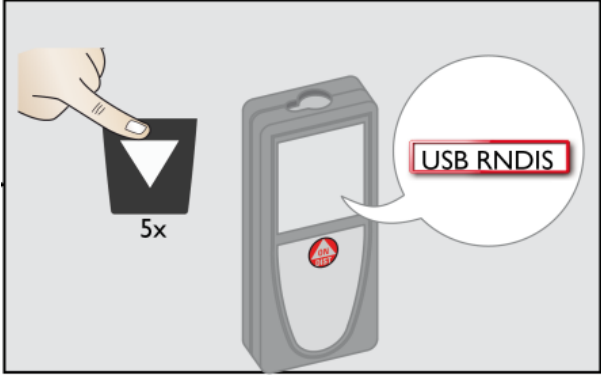
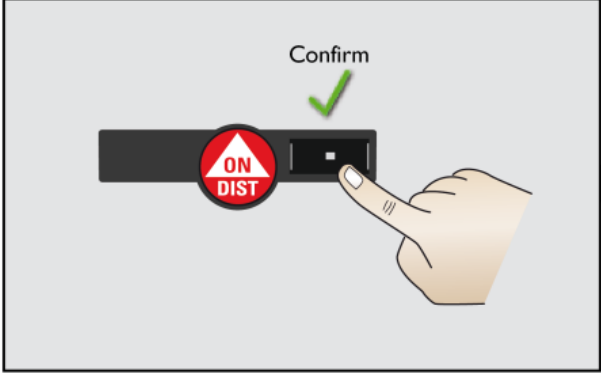



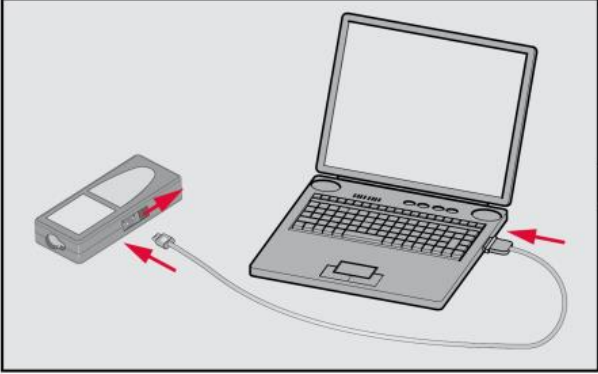
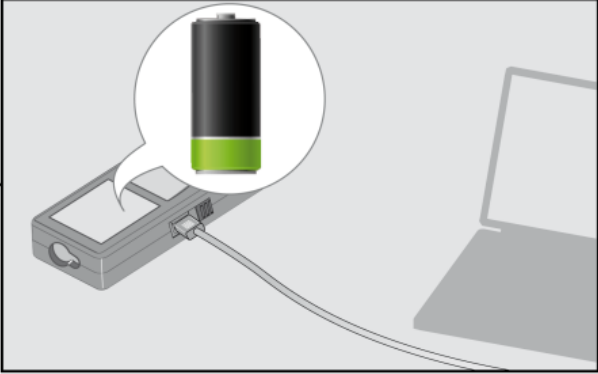
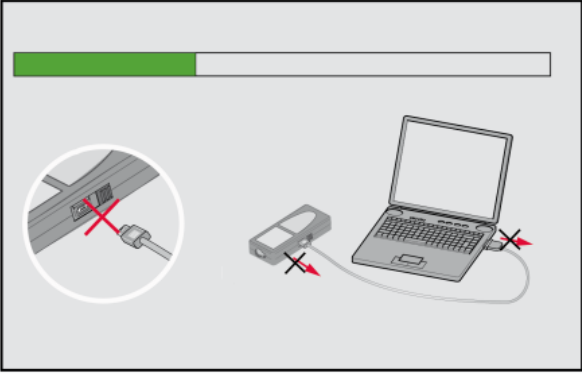

Update Firmware V 1705

<p>Precondition: You need Leica DISTO™ D810 touch, USB cable and a Windows PC.</p>	
	<p>1. Download program from webpage: http://ptd.leica-geosystems.com/en/Software-Leica-DISTO-D810-touch_104999.htm</p>
	<p>2. Execute the update program in order to install and follow instructions.</p>
	<p>3. Start update program on PC.</p>
	<p>4. Press button ON DIST to switch on device.</p>
	<p>5. Press six buttons in the same order as shown in picture.</p>

Update Firmware V 1705

	<p>6. Check firmware version: if it is less than 1705, proceed with step 7. If it is 1705, you do not need to continue, as you already have the new version installed on your device.</p>
	<p>7. Press key Down navigation to select entry USB RNDIS.</p>
	<p>8. Press selection key below green tackle to confirm.</p>
	<p>9. Press button C/OFF for two seconds to switch off device.</p>

Update Firmware V 1705

	<p>10. Connect device to laptop/PC via USB cable.</p>
	<p>11. Device switches on automatically. Battery icon appears on screen.</p>
<div style="border: 2px solid black; padding: 10px; text-align: center; font-size: 24px; font-weight: bold;">Start</div>	<p>12. Click button start to start installation process.</p>
	<p>13. A load beam appears on screen. Update process is running for about 10 minutes.</p> <p>Note! Do not disconnect device from laptop/PC during update process! An Error Message 5056 may shortly appear on DISTO™ display during installation.</p>
<p>Success </p>	<p>14. If the installation has been successful the message "success" and a green tackle appears on screen.</p>